Calibration Protocol – using a scale bar (e.g. from light microscopy, Golgi studies, etc.)

Kristen Harris Lab synapseweb.clm.utexas.edu Patrick Parker Sept. 2020

CALIBRATION SHOULD BE DONE **BEFORE** YOU START TRACING.

If you trace first and then calibrate, *all the traces will be wrong*. So calibrate first! (If you accidentally make a lot of traces before calibrating, there is a protocol to fix it. But it's best to calibrate first!)

Calibrating a new series


1. Go to the section with the scale bar.

2. Name a trace palette square calibrate_\$+. This will ensure that each line has a different number associated with it (e.g. calibrate_1, calibrate_2, etc.).

3. Zoom in as far as necessary to ensure accurate measurement. You can zoom in so far that you can't see the entire length of the scale bar and use the tool to pan across the screen to the other end of the scale bar. Here, you can see the left edge clear enough for accurate placement of the calibration line:



4. Using the "Draw Line" tool, trace the length of the scale bar. You might want to draw at least 2 lines to ensure accuracy. You can draw a line at the top and bottom.

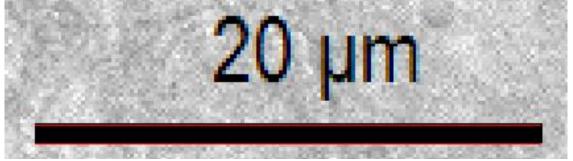

5. When your traces are completed, select all of the calibration traces.

6. Go to drop-down menu Trace > Calibrate > "Enter New Length" of [scale bar length in microns, in this case 20] > OK. Do this for each calibration trace.

Enter New Length	200	1.0	14.5	336	10-21	
Length of red1 in microns:	1	18. e	Č ? .		1.6	
20	21	٦.	112	•		
OK Cancel	21	u	111		1.3.	
		ñ. 9	1.	345		210
A BOARD						

7. Calibrate Traces: Select "Set pixel size to..." It will list the pixel size based on the average of the lengths of your calibration traces. OK.

Calibrate Traces					
 Resize selected trace(s) 					
 Set pixel size to 0.00224589 microns/pixel for domain: domain1 and optionally modify additional domains 					
C Scale entire section by 0.884207					
OK Cancel					

8. Set Pixel Size on All Domains: After "Last," enter the highest section number in your series to give the full Section Range > OK. The series is now calibrated.

Set Pixel Size on All Domains						
Section Range: First: 0 Last: 44						
Set pixel size to 0.0022458: microns/pixel						
This operation may disrupt existing alignments and it cannot be Undone.						
OK Cancel						

9. The original calibration traces will not be correctly sized after the pixel size adjustment. They should be deleted.

10. To verify that a series is calibrated, use the Draw Line tool to measure the length of the scale bar.

From Reconstruct User Manual (Fiala, Harris, & Sorra 2009), p. 4:

Calibrate Pixel Size

An important parameter during image import is the pixel size, which we ignored in the previous section. This parameter specifies the size of image picture elements (pixels) in terms of the units of measure of the series (Chapter 9). If the pixel size in the Import Images dialog was accurate, no further calibration is required. However in most cases the pixel size should be adjusted using the image of a calibration grid or scale that was photographed with the series. This is best done before any alignments or tracing, since changing the pixel size later can invalidate these adjustments.

The process of calibration in RECONSTRUCT[™] involves drawing traces of known length and then entering that length value into the program. Select the Line Tool (Fig. 1.2) from the Tools window and draw a line trace of known length on a section containing a calibration grid image. (For more details on calibration grids and lines see Chapter 9.)

After the calibration trace is drawn, select the *Calibrate...* item from the Trace menu. A dialog box will appear for each calibration trace displaying the current length of the trace. Enter the actual length of the trace in place of the current length.

When the lengths for all selected traces have been entered, a Calibrate Traces dialog will appear (Fig. 1.3) offering three options. Select the second option to set the correct pixel size for the current section. When the "Set Pixel Size on All Domains?" dialog appears, set the First Section to the first section of the series and the Last Section to the last section. Verify the value in the "Set pixel size to..." box and click the OK button. This will set the pixel size of all images in the series to the value determined from the calibration image. The pixel size for any image can be verified by using the Domain List while viewing the section in the main window.



Figure 1.3. The Calibrate dialogs as filled out for a global calibration of the pixel size of images. Top: The first dialog requests that a pixel size calibration be done for the image on which the calibration lines were traced. Bottom: The next dialog allows this same pixel size to be applied to every image in every section of the series.

Note that after calibration of pixel size, the calibration lines are no longer accurately matched to the calibration image on which they were drawn. This is to be expected. Since these calibration lines are no longer useful they can be deleted from the calibration section. An additional check on the calibration would be to redraw one or two calibration lines and verify that their length is now correct.